
Seismic Daily Report for 03 May 2008

3D Oil

3D Oil T41P 2D

T41P Bass Straight Australia

CGGVeritas: Pacific Titan

Contents

Daily Report for 03 May 2008	1
Daily Time and Activity Summary	1
Daily Timing	1
Prime Production	1
Total Daily Prime Production	1
Line Comments	1
Survey Totals	2
Total Survey Hours	2
Total Survey Prime Production	2
HSE	2
Exposure Hours	2
Incidents	2
Activities	3
Comments	3
Plots	4

Daily Report for 03 May 2008

Daily Time and Activity Summary

Start	End	Duration	Category	Code	Comment
00:00	07:28	7.467	SB	01	Continuation line TDOB08-027-065, completed within spec compass S1C20 knocked out in SPECTRA due to high bias. Streamer depth set to 9m due to sea state.
07:28	09:34	2.100	SB	02	Line change to line TDOB08-023-066.
09:34	10:00	0.433	DT	30	Commenced line TDOB08-023-066, terminated due to an airleak no usable data collected D.N.P. Circling around to reshoot the line.
10:00	13:29	3.483	DT	30	Circling around to line TDOB08-023-067 after previous line terminated for an airleak.
13:29	21:23	7.900	SB	01	Commenced line TDOB08-023-067, completed within spec compass S1C20 knocked out in SPECTRA due to high bias. Streamer depth set to 9m due to sea state.
21:23	23:48	2.417	SB	02	Line change to line TDOB08-025-068.
23:48	24:00	0.200	SB	01	Commenced line TDOB08-025-068, MSP 1068 compass S1C20 knocked out in SPECTRA due to high bias.

Daily Timing

Code	Comment	Client Time	Contractor Time	Duration
01	Prime - Acquisition	15.567		15.567
02	Prime - Line Change	4.517		4.517
30	Source		3.917	3.917
	Totals	20.08	3.92	24.00

Prime Production

seq	line	dir	FCSP	LCSP	KM	KMFF	CMP
065	TDOB08-027-065	307	1214	3649	60.90000	57.90000	60.90000
067	TDOB08-023-067	129	3914	1001	72.85000	69.85000	72.85000
068	TDOB08-025-068	307	1001	1068	1.70000	1.70000	1.70000

Total Daily Prime Production

KM	KMFF	CMP
135.45000	129.45000	135.45000

Line Comments

Seq	Line	Comments
065	TDOB08-027-065	Recording line TDOB08-027-065, MSP 1213 compass S1C20 knocked out in SPECTRA due to high bias. Streamer depth set to 9m due to sea state. Random swell bursts evident throughout the line. Numerous gun string depth errors recorded but less than 4.9m and nothing over 7.2m this was caused by the heavy swell of 5m and line heading.
066	TDOB08-023-066	Recording line TDOB08-023-066, line terminated early due to an airleak no usable data recorded D.N.P.

Seq	Line	Comments
067	TDOB08-023-067	Recording line TDOB08-023-067, completed within spec compass S1C20 knocked out in SPECTRA due to high bias. Streamer depth set to 9m due to sea state. Random swell bursts evident throughout the line. There were a number of false autofires reported by GUN 3-7 throughout the line due to leakage on the sensor line these were checked out by seis QC and found to false. SP gun 3-7 disabled and spare gun 1-4 enabled array volume still 3040cu ins.
068	TDOB08-025-068	Recording line TDOB08-0253-068, MSP 1068 compass S1C20 knocked out in SPECTRA due to high bias.

Survey Totals

Total Survey Hours

Code	Comment	Client Time	Contractor Time	Duration
01	Prime - Acquisition	228.350		228.350
02	Prime - Line Change	118.967		118.967
19	Transit from midpoint between Cue Energy & 3D Oil	2.750		2.750
30	Source		8.667	8.667
35	Instruments		7.233	7.233
38	Towing		3.033	3.033
	Totals	350.07	18.93	369.00

Total Survey Prime Production

KM	KMFF	CMP
2080.32500	1888.35000	2080.32500

Percent Survey Completed by KMFF = 94.04%

Percentage Survey Completed by sail CMP = 94.43%

HSE

Exposure Hours

Type	03 May	Cumulative
client_hours	24	384
maritime_hours	384	6144
seismic_hours	384	6144
third_party_hours	24	384
Total	816	13056

Total man days: 544

Incidents

Type	03 May	Cumulative
Fatality	0	0
Lost Time Incident	0	0
Medical Treatment	0	0

Type	03 May	Cumulative
First Aid	0	0
Restricted Work	0	0
Material Loss/Damage	0	0
Environmental Incident/Damage	0	0
Near Miss	0	0
Hazard	0	0
Unsafe Act	0	0
Total	0	0

Comments

6 Toolbox meetings held at shift change.

1 Toolbox meeting held for source retrieval.

1 Toolbox meeting held for source deployment.


Activities

Type	03 May	Cumulative
Safety Drills	0	2
Safety Meetings	0	0
Boat Launches	0	0
Boat Transfers	0	0
Toolbox Meetings	8	109
Helicopter Landings	0	0
Safety Audit - Internal	0	0
Safety Audit - External	0	0


Comments

Production down slightly due to an extended line change for gun work and also one circle for an airleak. Lines completed were TDOB08-027 & 023 and line 025 until midnight. Line TDOB08-023-067 had numerous false autofires due to leakage on the sensor line of gun 3-7 these were confirmed by the Seis QC as being false, at SP 3648 gun 3-7 was disabled and the spare gun 1-4 enabled array volume remained at 3040cu ins.

Plots

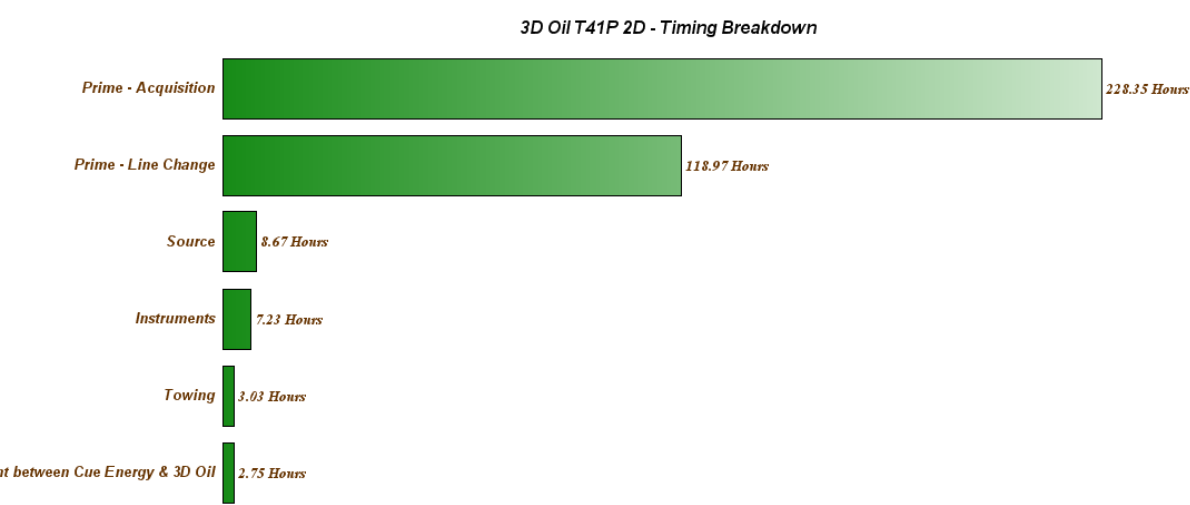

created with ChartDirector from www.advsofteng.com

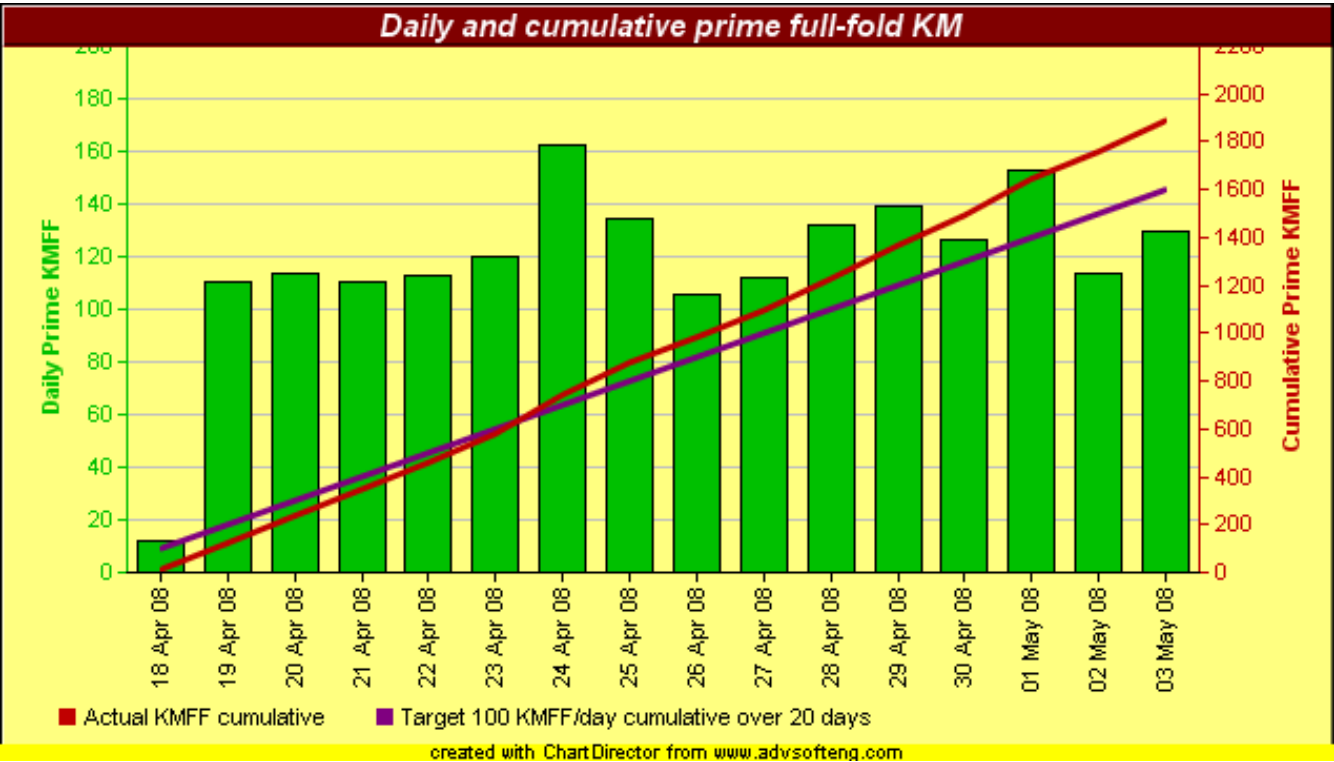

created with ChartDirector from www.advsofteng.com