
Seismic Daily Report for 21 Apr 2008

3D Oil

3D Oil T41P 2D

T41P Bass Straight Australia

CGGVeritas: Pacific Titan

Contents

Daily Report for 21 Apr 2008	1
Daily Time and Activity Summary	1
Daily Timing	1
Prime Production	1
Total Daily Prime Production	1
Line Comments	2
Survey Totals	2
Total Survey Hours	2
Total Survey Prime Production	2
HSE	2
Exposure Hours	2
Incidents	3
Activities	3
Comments	3
Plots	4

Daily Report for 21 Apr 2008

Daily Time and Activity Summary

Start	End	Duration	Category	Code	Comment
00:00	02:51	2.850	SB	01	Continuation line TDOB08-042-011, completed compass S1C20 knocked out in SPECTRA due to high bias, no GPS data from tailbuoy.
02:51	04:25	1.567	SB	02	Line change to line TDOB08-026-012.
04:25	06:12	1.783	SB	01	Commenced line TDOB08-026-012, completed within spec compass S1C20 knocked out in SPECTRA due to high bias and no GPS data from the tailbuoy.
06:12	08:03	1.850	SB	02	Line change to line TDOB08-040-013.
08:03	09:40	1.617	SB	01	Commenced line TDOB08-040-013, completed within spec compass S1C20 knocked out in SPECTRA due to high bias and no GPS data from the tailbuoy.
09:40	11:42	2.033	SB	02	Line change to line TDOB08-007-014.
11:42	13:11	1.483	SB	01	Commenced line TDOB08-007-014, completed within spec compass S1C20 knocked out in SPECTRA due to high bias and no GPS data from the tailbuoy.
13:11	15:05	1.900	SB	02	Line change to line TDOB08-001-015.
15:05	17:00	1.917	SB	01	Commenced line TDOB08-001-015, completed within spec compass S1C20 knocked out in SPECTRA due to high bias and no GPS data from the tailbuoy.
17:00	18:29	1.483	SB	02	Line change to line TDOB08-016-016.
18:29	23:10	4.683	SB	01	Commenced line TDOB08-016-016, completed within spec compass S1C20 knocked out in SPECTRA due to high bias and no GPS data from the tailbuoy.
23:10	24:00	0.833	SB	02	Line change to line TDOB08-052-017.

Daily Timing

Code	Comment	Client Time	Contractor Time	Duration
01	Prime - Acquisition	14.333		14.333
02	Prime - Line Change	9.667		9.667
	Totals	24.00	0.00	24.00

Prime Production

seq	line	dir	FCSP	LCSP	KM	KMFF	CMP
011	TDOB08-042-011	236	2038	1001	25.95000	22.95000	25.95000
012	TDOB08-026-012	058	1001	1649	16.22500	13.22500	16.22500
013	TDOB08-040-013	237	1604	1001	15.10000	12.10000	15.10000
014	TDOB08-007-014	331	1001	1553	13.82500	10.82500	13.82500
015	TDOB08-001-015	143	1667	1001	16.67500	13.67500	16.67500
016	TDOB08-016-016	054	1001	2637	40.92500	37.92500	40.92500

Total Daily Prime Production

KM	KMFF	CMP
128.70000	110.70000	128.70000

Line Comments

Seq	Line	Comments
011	TDOB08-042-011	Recording line TDOB08-042-011, MSP 2039 compass S1C20 knocked out in SPECTRA due to high bias, no GPS data from tailbuoy.
012	TDOB08-026-012	Recording line TDOB08-026-012, completed within spec compass S1C20 knocked out in SPECTRA due to high bias, no GPS data from tailbuoy.
013	TDOB08-040-013	Recording line TDOB08-040-013, completed within spec compass S1C20 knocked out in SPECTRA due to high bias, no GPS data from tailbuoy.
014	TDOB08-007-014	Recording line TDOB08-007-014, completed within spec compass S1C20 knocked out in SPECTRA due to high bias, no GPS data from tailbuoy.
015	TDOB08-001-015	Recording line TDOB08-001-015, completed within spec compass S1C20 knocked out in SPECTRA due to high bias, no GPS data from tailbuoy.
016	TDOB08-016-016	Recording line TDOB08-016-016, completed within spec compass S1C20 knocked out in SPECTRA due to high bias, no GPS data from tailbuoy. Occasional false depth reading reported from source string 3 due to faulty depth transducer 2.

Survey Totals

Total Survey Hours

Code	Comment	Client Time	Contractor Time	Duration
01	Prime - Acquisition	44.500		44.500
02	Prime - Line Change	26.967		26.967
19	Transit from midpoint between Cue Energy & 3D Oil	2.750		2.750
35	Instruments		3.750	3.750
38	Towing		3.033	3.033
	Totals	74.22	6.78	81.00

Total Survey Prime Production

KM	KMFF	CMP
392.20000	347.22500	392.20000

Percent Survey Completed by KMFF = 17.29%

Percentage Survey Completed by sail CMP = 17.80%

HSE

Exposure Hours

Type	21 Apr	Cumulative
client_hours	24	96
maritime_hours	384	1536

Type	21 Apr	Cumulative
seismic_hours	384	1536
third_party_hours	24	96
Total	816	3264

Total man days: 136

Incidents

Type	21 Apr	Cumulative
Fatality	0	0
Lost Time Incident	0	0
Medical Treatment	0	0
First Aid	0	0
Restricted Work	0	0
Material Loss/Damage	0	0
Environmental Incident/Damage	0	0
Near Miss	0	0
Hazard	0	0
Unsafe Act	0	0
Total	0	0

Comments

6 Toolbox meetings held at shift change.


Activities

Type	21 Apr	Cumulative
Safety Drills	0	0
Safety Meetings	0	0
Boat Launches	0	0
Boat Transfers	0	0
Toolbox Meetings	6	29
Helicopter Landings	0	0
Safety Audit - Internal	0	0
Safety Audit - External	0	0


Comments

Very good day's production with lines TDOB08-042, 026, 040, 007, 001 & 016 being completed.

Plots

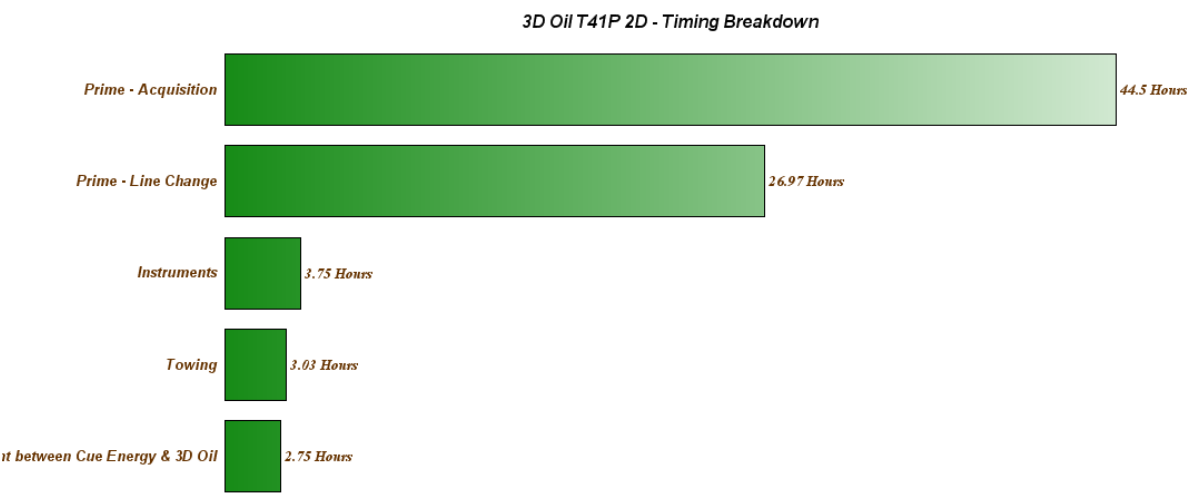

created with ChartDirector from www.advsofteng.com

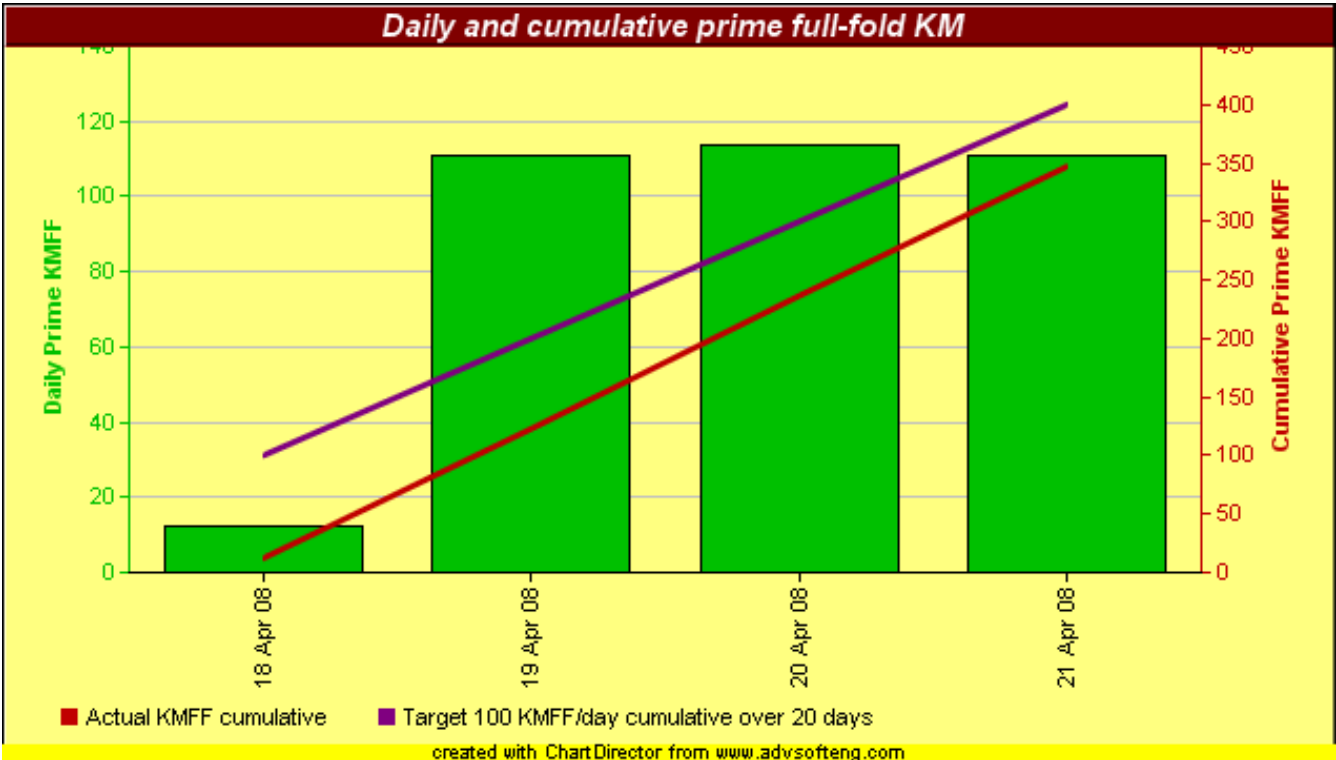

created with ChartDirector from www.advsofteng.com