

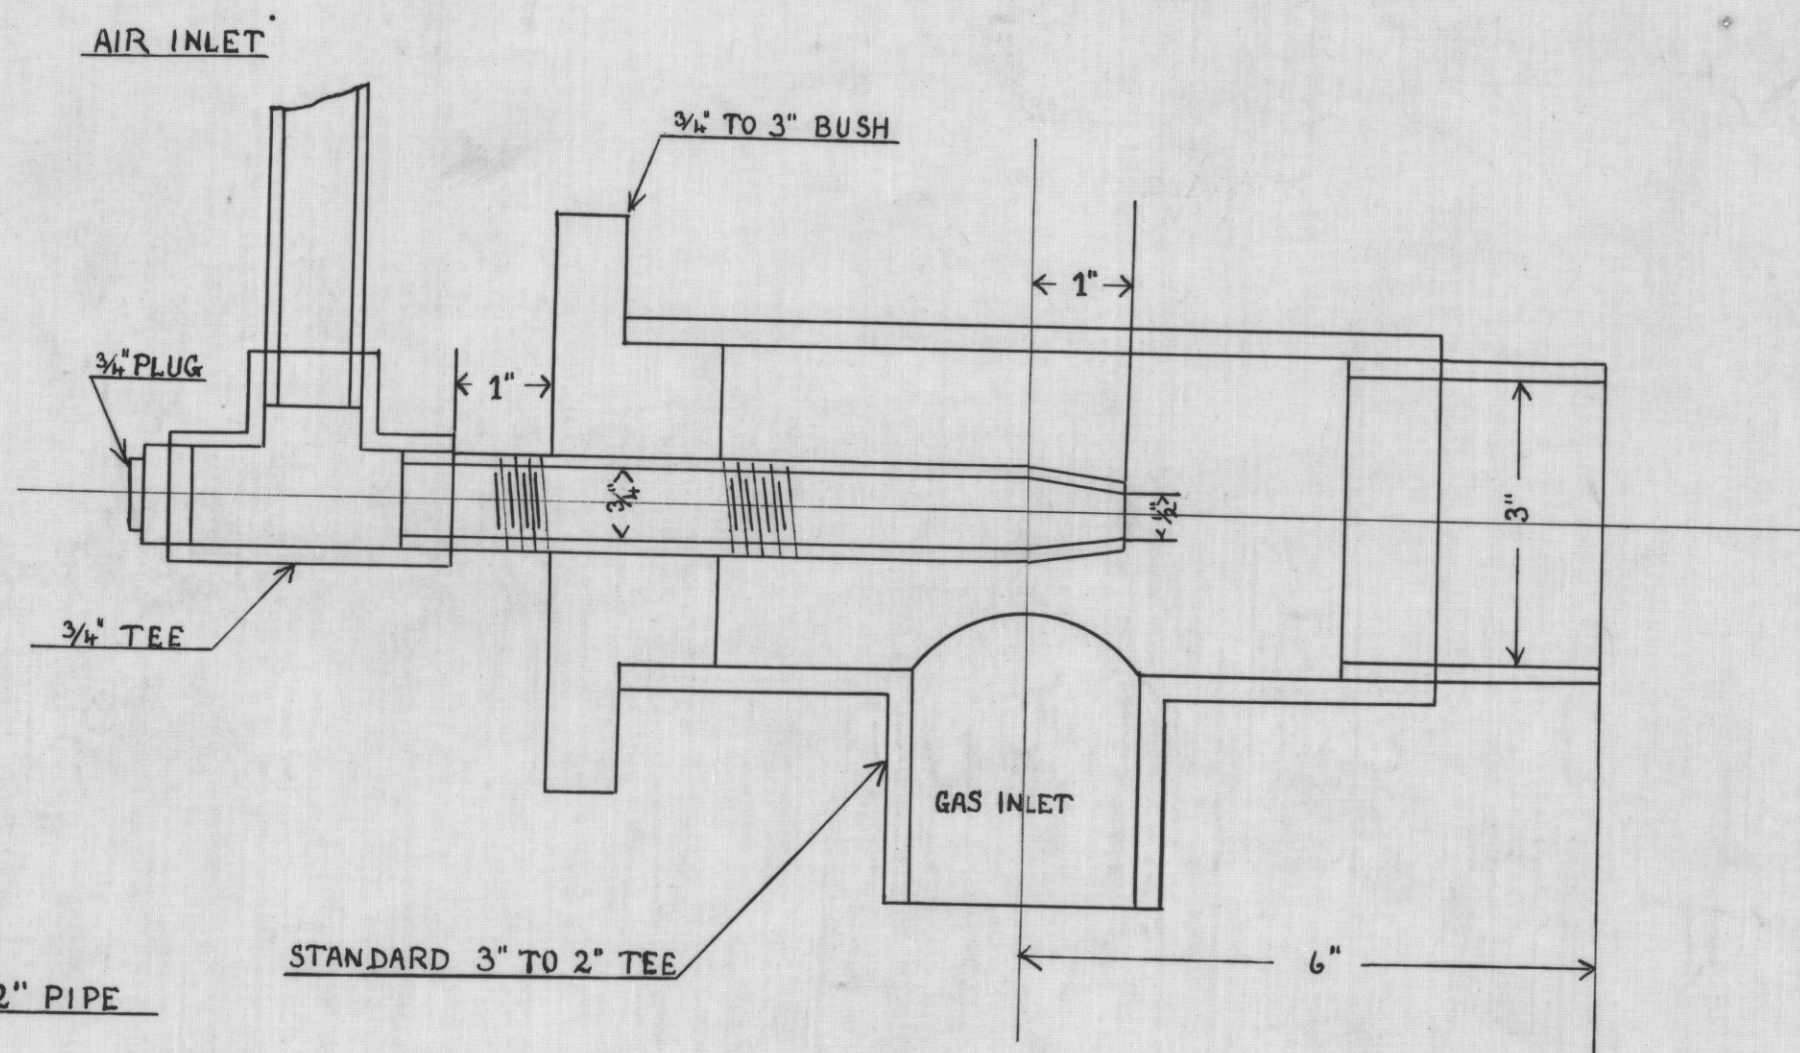
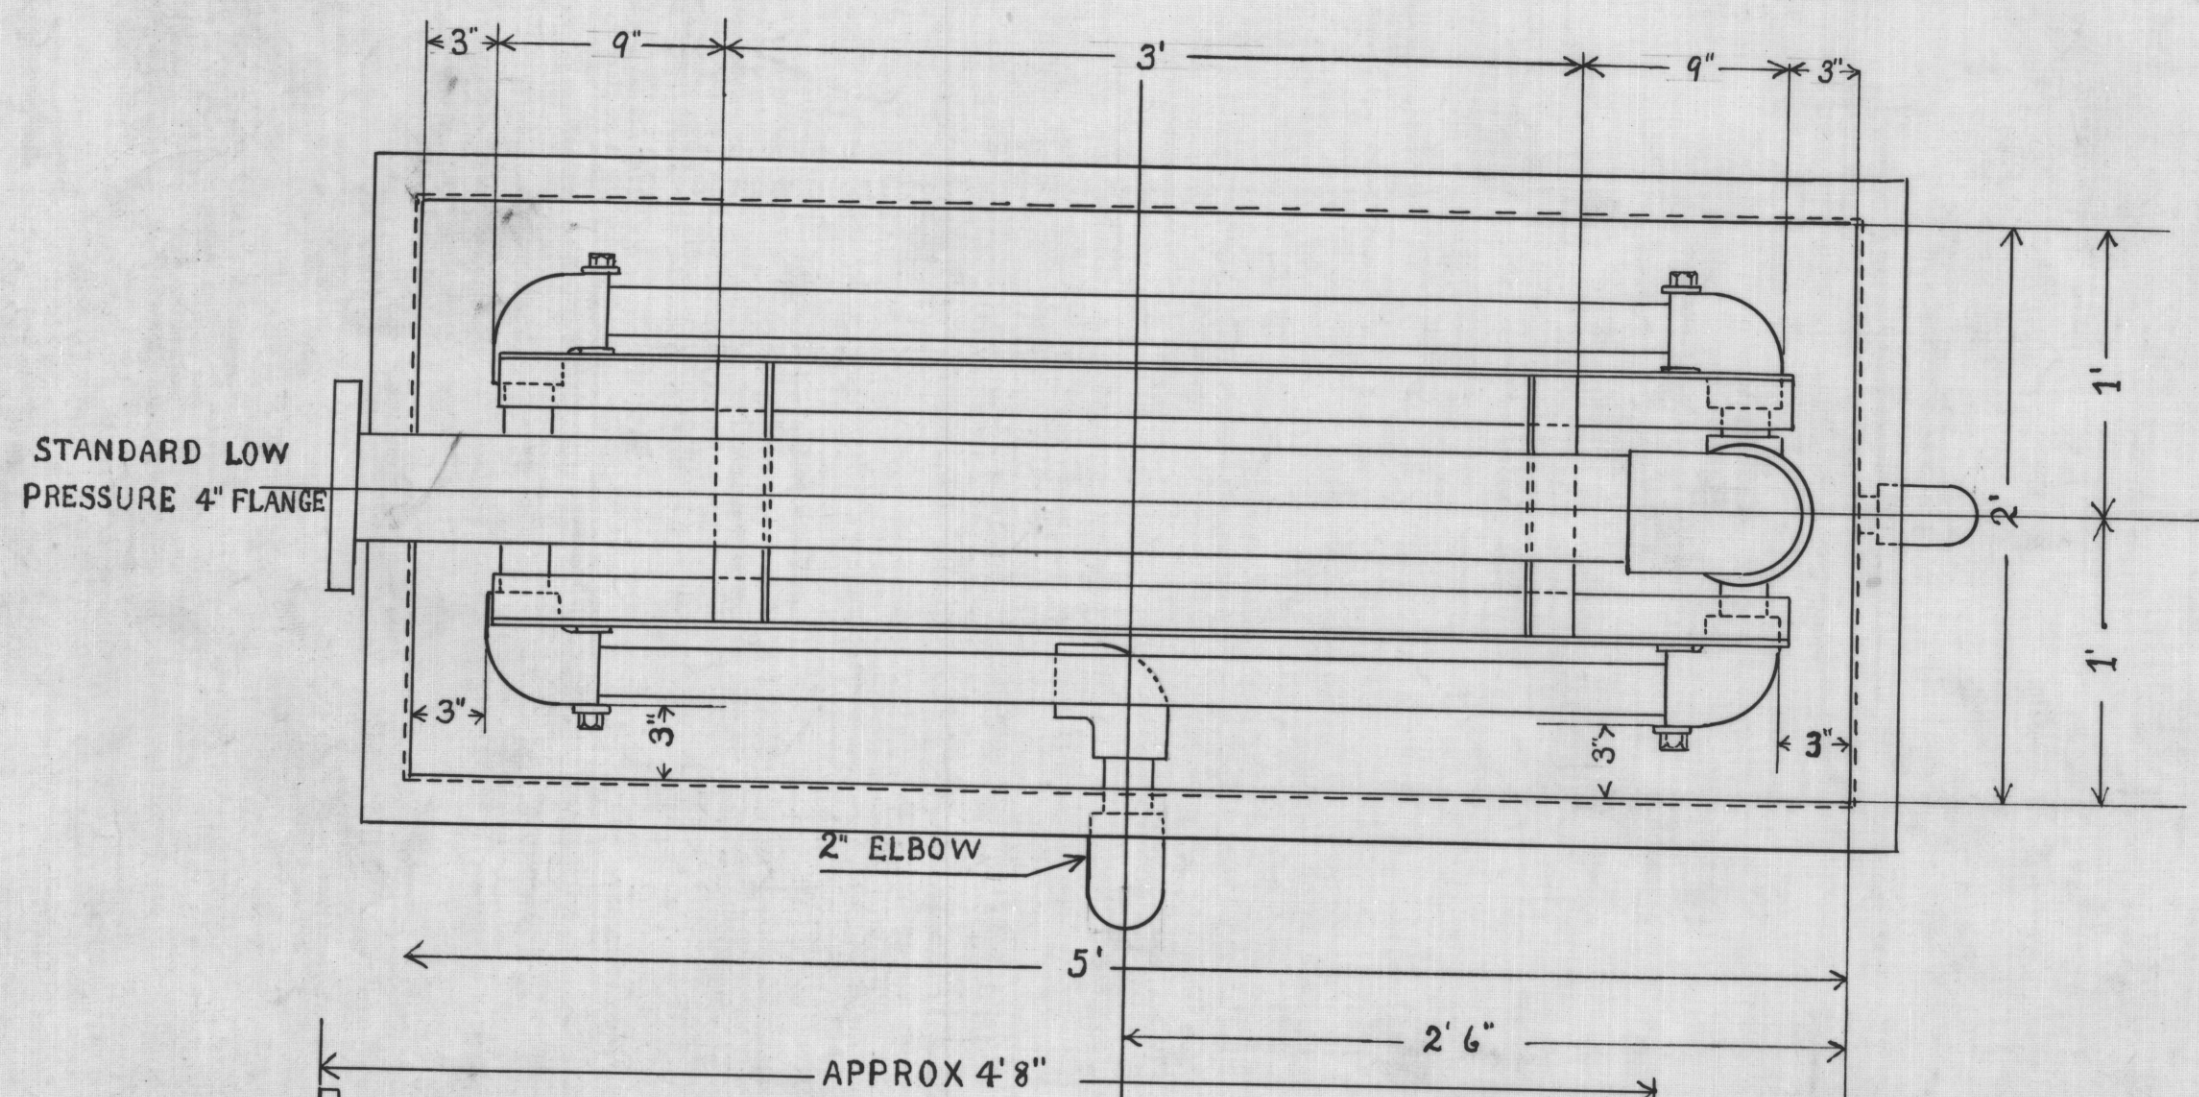


5 cm

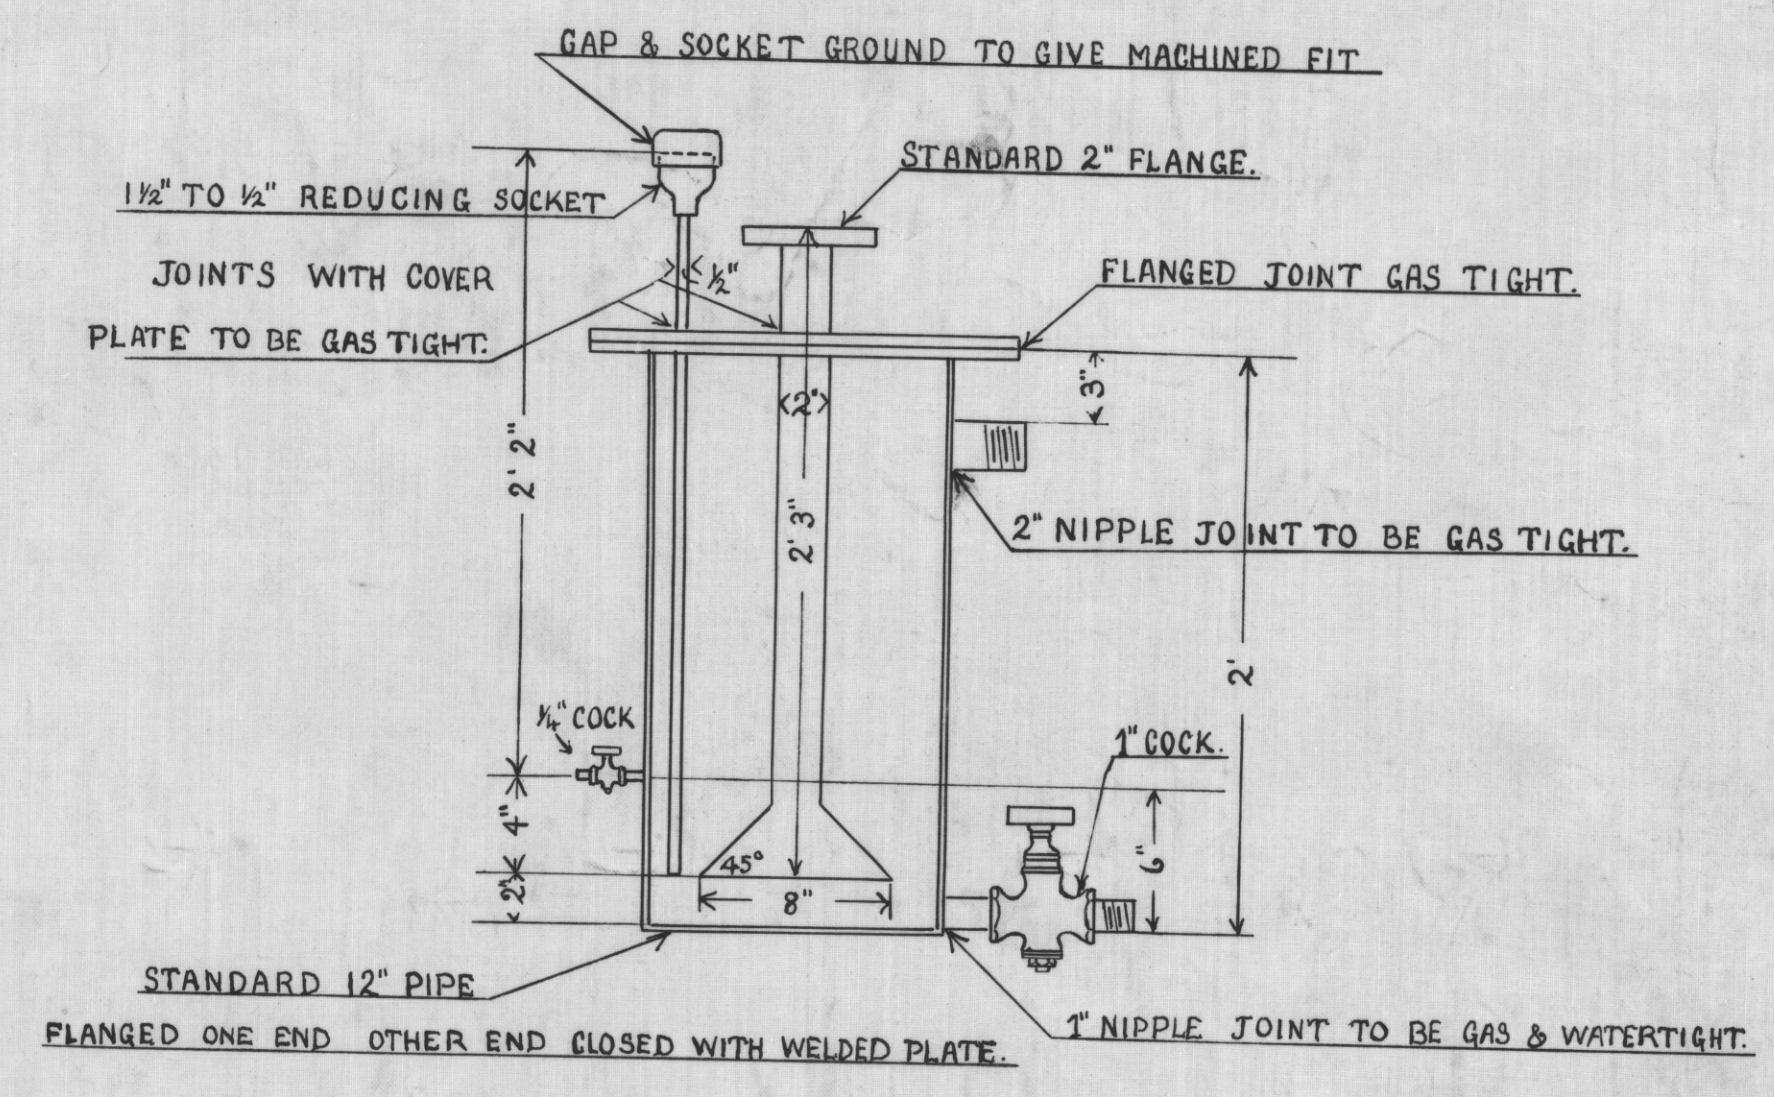

GAS BURNER FOR GAS AT ATMOSPHERIC PRESSURE.  
MAKE 1.

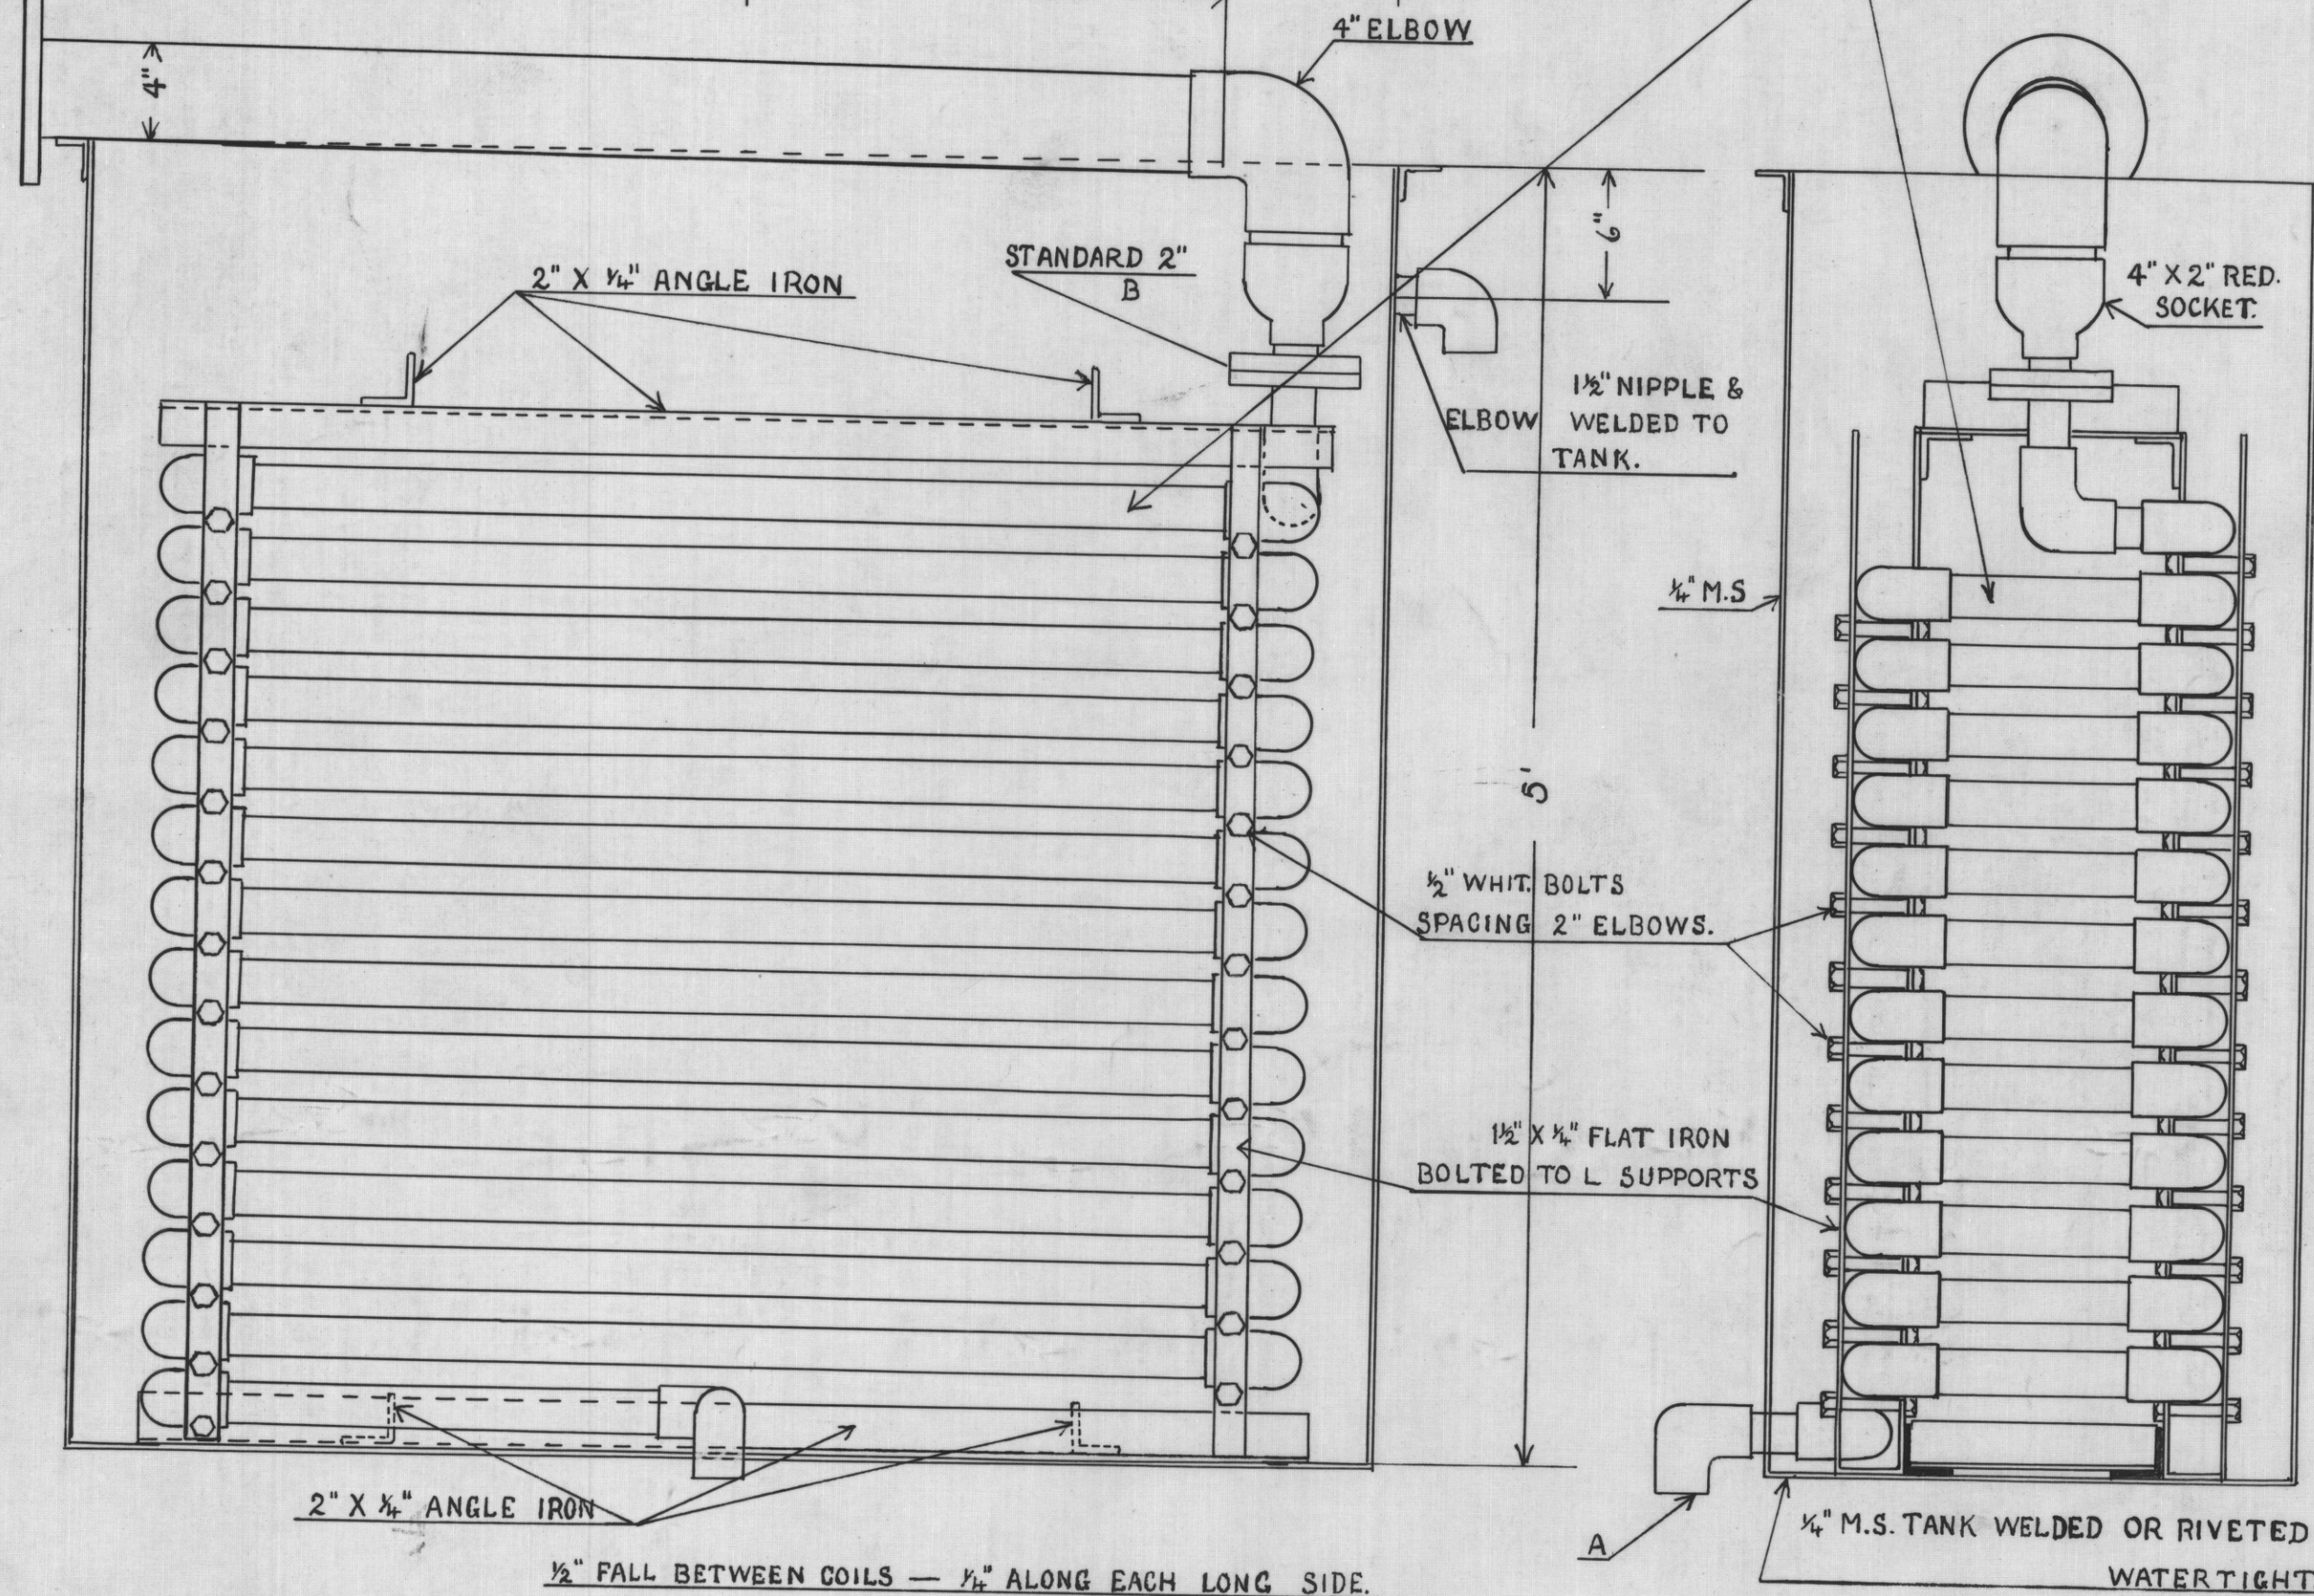

SAFETY TRAP FOR GAS LINE. MAKE 1.

CONDENSER — MAKE 1 AS SHOWN & 1 WITH EXIT 'A' ON OPPOSITE SIDE OF TANK.

2" FLANGES AT 'B' NOT TO BE BOLTED TOGETHER.  
CONDENSER FRAME MAY BE SUPPORTED FROM TANK IF TANK IS KEPT WATER TIGHT.  
ALL PIPE JOINTS NOT WELDED TO BE MADE WITH RED LEAD & BOILED LINSEED OIL  
COIL TO BE LEAK PROOF AT 50 LBS PER SQ. IN.

TASMANIAN GOVERNMENT MINES DEPARTMENT.  
TASMANITE ASPHALT CONVERTER.  
DETAIL DRAWING NO. 2. SCALE 1 1/2" = 1 FT & 3 IN = 1 FT.

A Walker.

348/M

9-740 F